




A leading worldwide distributor since 1982

Hysecurity Nice Apollo 1050 Board BlueBus (BluBus) Error

All gate openers produced by Nice USA / Apollo Gate Openers / Nice Apollo with a 1050 control board after 2016 must meet UL325. This started the need to have monitored entrapment devices for gate openers to function. Part of the initial setup is going to scan for BluBus (BlueBus)- This is looking for a Nice Photo eye connected to the gate opener.

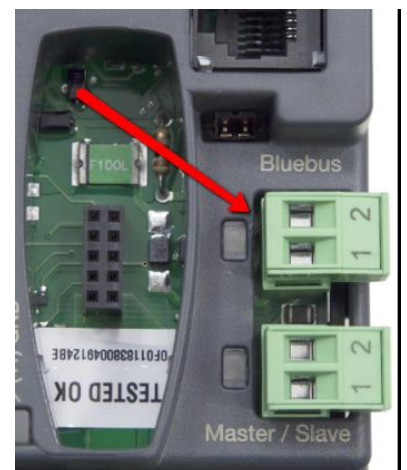

Ways to fix BluBus Error:

- Connect a Nice MOFB/A | EPLOB/A | EPMB/A | EPMOB/A
 - The photo eye must be installed to work
- Connect a 3rd party compatible monitored photo eye or edge protector

Please consult UL325 to make sure your application meets the current standards.

DF Supply, Inc. • 8500 Hadden Road • Twinsburg, OH 44087

Toll-free: (800) 878-7829 • Local: (330) 650-9226 • Fax: (330) 650-9004

Email: sales@dfsupplyinc.com • Web: www.dfsupplyinc.com